Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment © 100% Report

595 Character Area C

596	Character Area C is located to the east of Character Area A, near the visitor center.				
597	Emigrant trails are generally not visible in this area, due to the impacts of several phases of				
598	road construction, realignment and widening associated with the county road Old Oregon				
599	Trail.				
600	Existing Condition				
601	• The topography within this area is primarily flat with a few small depressions and				
602	ridges.				
603	 Views to the east are open with little topography visible. Mitchell Pass, Scotts Bluff 				
604	and South Bluff are visible to the west.				
605	 County road Old Oregon Trail has covered significant sections emigrant trail 				
606	resources in this character area. Indistinct trail rut resources are located both north				
607	and south of the county road county road Old Oregon Trail and others have been				
608	covered by road construction.				
609	 Two locations of unidentified ruts/tracks are located within this area. 				
610	• A bike trail extends east from the visitor center parking lot, generally parallel to and				
611	north of the county road.				
612	 The only contemporary improvements have been the addition of the compatible 				
613	wooden trail markers.				
614	• The eastern red cedar plantings occur along portions of the unidentified ruts and are				
615	non-contributing, compatible.				
616	Analysis				
617	<u>Trail Rut Resource</u>				
618	• The majority of the emigrant trail ruts in Character Area C are Class 5 (approximate				
619	original trail). The location of the emigrant trail in these sections is only known				
620	approximately from historic maps and photographs and is not visible. If the				
621	resources are extant under the road (further investigation is needed) they would				
622	contribute to the significance of the historic landscape.				
623	<u>Visitor Experience</u>				
621					

• Visitors enter the Monument from the east via the walking/biking trail in this area.

Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment 🖸 100% Report

- 625 Visitors who visit this area have an opportunity to experience the approach of 626 Mitchell Pass and the views Scotts Bluff and South Bluff in much the same way
- 627 emigrants did.
- 628 There is little visual evidence of emigrant trail ruts in this area thus hindering visitor 629 understanding of how settlers reached Mitchell Pass.
- 630



- 631 632
- Figure 3 39. Unidentified ruts with eastern red cedar plantings in Character Area C (2009) 633 (MBD DSC_0050.JPG)

3-56

634

Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment 🖸 100% Report



635 636 637

638





639 640

Figure 3 - 41. North side of county road Old Oregon Trail looking west in Character 641 Area C (2009) (MBD DSC_0058.JPG)

642

Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment 🖸 100% Report



643 644

Figure 3 - 42. North side of county road Old Oregon Trail looking east in Character 645 Area C (2009) (MBD DSC_0061.JPG)

646



647 648

Figure 3 - 43. Asphalt bike trail in Character Area C looking east (2009) (MBD 649 DSC_0061.JPG)

650

Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment 100% Report

651 652

Table 4: Character Area C - Small Scale Features


Feature	Figure #	Description	Condition	Contributing/Non- contributing
Boy Scout Trail Marker	3-24	Wood post with emblems indicating trail location of Oregon Trail/California Trail/Pony Express	Good	non-contributing compatible <i>outside period of significance</i>
Asphalt Trail	3-43	Asphalt bike trail	Good	non-contributing compatible location does not detract from the historic landscape

653

3-59

Scotts Bluff National Monument Oregon Trail Ruts Landscape Study and Environmental Assessment

100% Report

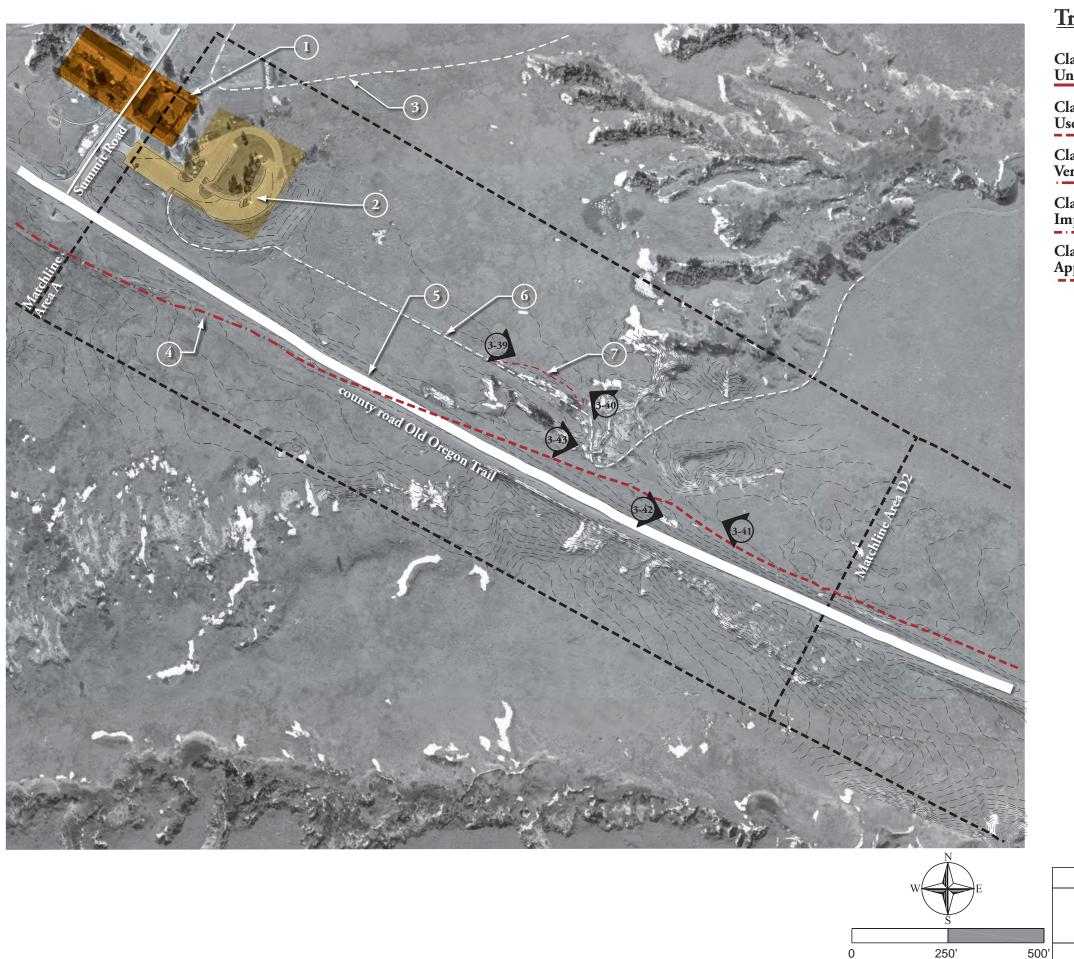

Trail Class

Class 1 -<u>Unalter</u>ed Origi

Class 2 -Used Original T

Class 3 -Verified Origina

Class 4 -Impacted Origin

Class 5 -Approximate Or

<u>sification</u>	Legend			
ginal Trail		Visitor Center/ Administra- tion Offices/ Maintenance Shop/ Employee Residence		
Trail	2	Parking		
al Trail	3	Saddle Rock Trail		
inal Trail	4	Trail Ruts Location - Class 5 (Approximate Original Trail)		
Driginal Trail	5	Trail Ruts Location - Class 5 (Under Road) (Approximate Original Trail		
	6	Bike Trail		
	7	Unidentified Ruts/Tracks		
	3-1	Photo Reference Figure #		

FIGURE 3-44

UNITED STATES DEPARTMENT OF THE INTERIOR NATIONAL PARK SERVICE SCOTTS BLUFF NATIONAL MONUMENT TITLE OF PROJECT OREGON TRAIL RUTS LANDSCAPE STUDY ENVIRONMENTAL ASSESSMENT DRAWING TITLE CHARACTER AREA C - EXISTING CONDITIONS NAME OF PARK SCOTTS BLUFF NATIONAL MONUMENT <u>REGION</u> COUNTY MIDWEST SCOTTS BLUFF NEBRASKA